




STP Plug Termination Instruction

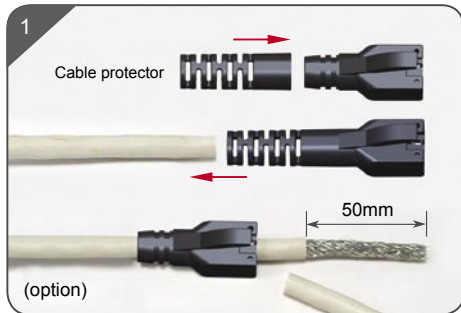


- 1. Put cable protector & boots together, and install to the cable before stripping.
- 2. Strip the cable jacket length about 50mm.

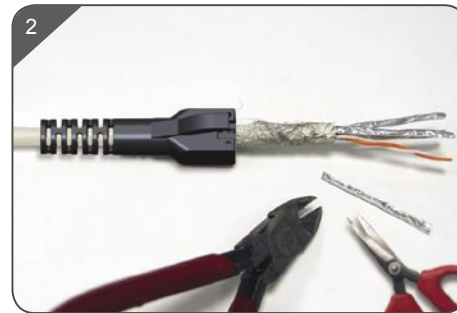


- Bend back the copper braid over plastic jacket, cut each pair's aluminum foil to root.

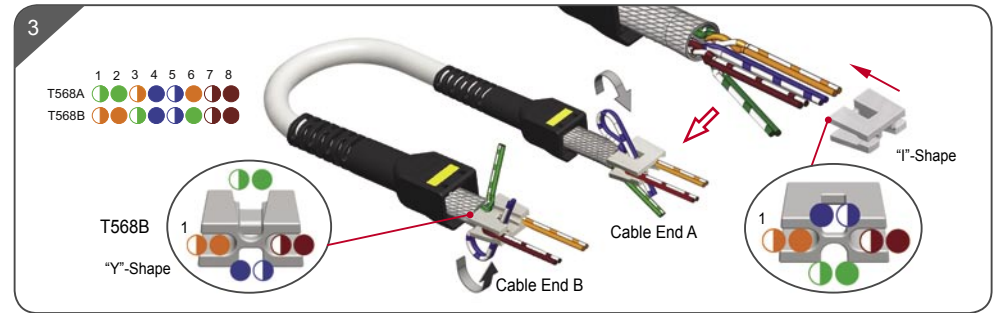


- Insert 4 pair wires into the organizer, Blue pair direct to "I-shape" organizer tunnel. Green pair direct to "Y-shape" organizer slot.

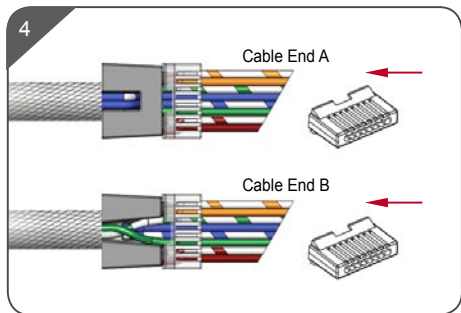


- Select indented loadbar side on top, thread loadbar, comb each pair wires.

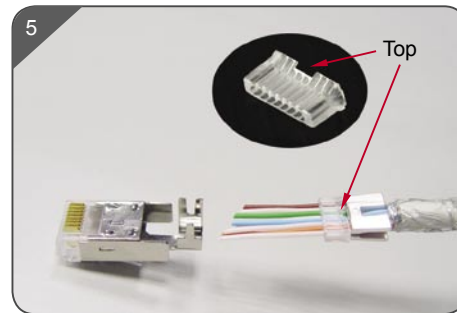


- Plug contacts and indented loadbar side are on the top, and cut the excessive wires.

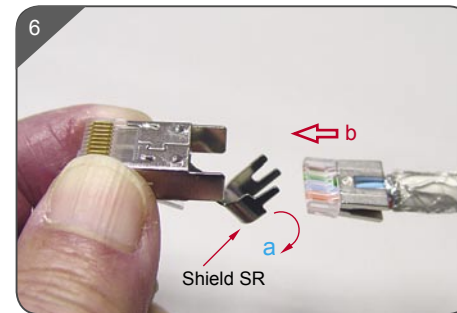


- a. Turn the shield SR(hook) down as arrow a.
- b. Push wire-organizer assembly into plug housing as arrow b.

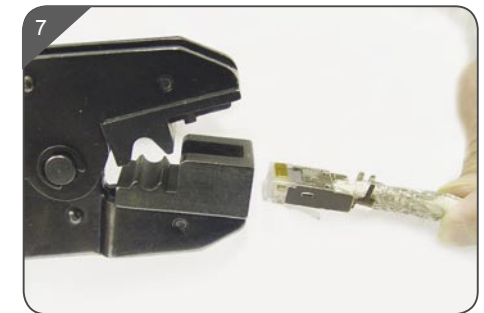


- Crimp and terminate the wires, by crimping tool.

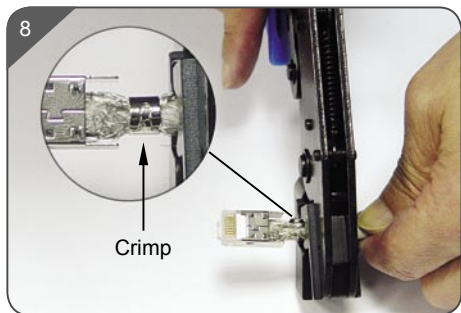


- Crimp shield SR(hook) with copper braid.

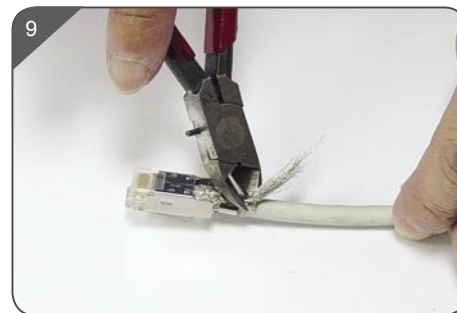

- Cut the excessive copper braid.

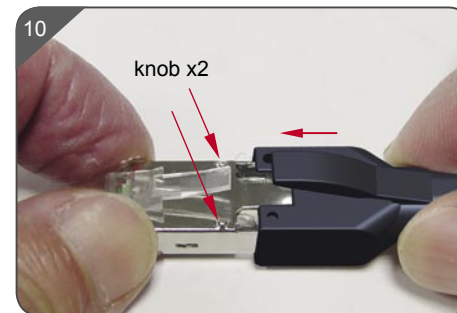

- Position boots with 2 knobs.

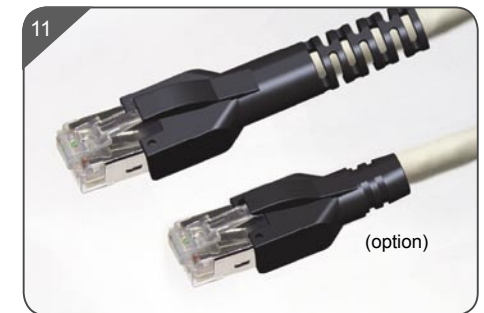

- Complete.

